# STS-124/1J

# FD 08 Execute Package



MSG	Page(s)	Title
062A	1 - 15	FD08 Flight Plan Revision (pdf)
063	16 - 17	FD08 Mission Summary (pdf)
064	18 - 19	FD08 Transfer Message (pdf)
065	20	FD08 MMT Summary (pdf)
069	21	Lab RWS SSC Reposition (pdf)
072	22 - 44	1.104 JEMRMS Partial Deploy to EVA 3 Start (pdf)
061		JEMRMS All Stop Protocol (pdf - Electronic Only)
066		FD8 PAO Event Summary - CNN, WCBS-TV, WDAY-TV (pdf - Electronic Only)
067		FD8 PAO Event Summary - Japanese PM VIP Call (pdf - Electronic Only)
068A		Stowage Locations for FD08 Plan (GMT 159/160) (pdf - Electronic Only)

Approved by FAO: Jaime Marshik

Last Updated: Jun 7 2008 9:44AM GMT

JEDI (Joint Execute packer T Last Updated: Jun 7 2008 9:44AM GMT

JEDI (Joint Execute package Development and Integration), v2.04.0003

### MSG INDEX

3	MSG NO.	<u>TITLE</u>
4	061	JEMRMS ALL STOP PROTOCOL
5	062	FD08 FLIGHT PLAN REVISION
6	063	FD08 MISSION SUMMARY
7	064	FD08 TRANSFER MESSAGE
8	065	FD08 MMT SUMMARY
9	066	FD8 PAO Event Summary - CNN, WCBS-TV, WDAY-TV
10	067	FD8 PAO Event Summary - Japanese PM VIP Call
11	068	Stowage Locations for FD08 Plan (GMT 159/160)
12	069	Lab RWS SSC Reposition
13	070	FD08 EVA Deltas
14	072	1.104 JEMRMS Partial Deploy to EVA 3 Start

### 1. Post Sleep Cryo Config

For today's cryo config, the active tanks will be O2 Tanks 2, 3 and 4, and H2 Tanks 2 and 5.

# R1 O2, H2 MANF VLV TK2 (two) - OP (tb-OP) O2 TK3 HTRS A, B (two) - AUTO

#### A11 CRYO TK4 HTR O2 A - AUTO

### A15 CRYO TK5 HTR O2 A - OFF

# 2. Cryo System Reconfig

Due to the potential for destratification in CRYO tanks during vehicle maneuvers, EGIL has inserted steps into today's timeline, prior to the maneuver to the Waste Dump attitude to preemptively activate cryo heaters. Once the maneuvers are completed, EGIL will provide additional steps real-time to reconfigure the CRYO system.

### 3. FCMS Items

Due to a nuance with the onboard network, the FCMS data file may not automatically be copied to the KFX laptop at the end of the procedure. If you receive an error message stating "There was a problem copying the file. Try copying the file manually," notify MCC and we will downlink the file from the WINDECOM laptop.

#### Items for Aki

- a. Could you report the S/Ns or the B/Cs for the power cables, power supplies, network cables and multi-use brackets/desks specific to each "laptop" for the two SSC's installed in the JPM?
- b. Thank you for your hard work every day. Yesterday we noticed that one of the two cabin duct maintenance caps was floating in the JPM. Please stow this duct cap and confirm that both duct caps are in the Equipment Bag Assy "1J Activation Kit" (P/N G11F5160-1) at JPM1D7.
- c. We noticed in a photo that the FDS partition at JPM1F6 is peeled off. Please reattach the FDS partition and report the status to SSIPC.

### 5. Missing PWR S/N 2002

PWR S/N 2002 was reported missing. The last known location of this PWR was A/L1D1\_B2. Another possible location could be near the OGS rack. If not at either of these locations, check with an ISS crewmember to determine alternate location of this PWR. If PWR S/N 2002 is not found, dump remaining PWRs S/Ns, 1007, 1025, 2003, and 2004 as planned. Report status of PWR S/N 2002 to MCC-H.

### 6. Waste Water/PWR Dumps

The waste tank (waste dump line) and 5 PWRs (supply dump line) will be dumped simultaneously. Once the Waste Water Dump is complete, 2 CWCs will be dumped through the waste line. DO NOT dump the PWRs and CWCs simultaneously to preclude nozzle icing.

Prior to opening either dump valve, verify with MCC-H in proper dump attitude.

#### a. WASTE WATER DUMP

Perform a Waste Water Dump using <u>SUPPLY/WASTE WATER DUMP</u> (ORB OPS, <u>ECLS</u>) p. 5-2. MCC-H will TMBU limits. Dump the waste tank to 5%. Waste nozzle open time will be ~15 minutes.

After completing Step I-2 (dump termination), proceed directly to <u>CWC</u> OVERBOARD DUMP (see item 7 below).

#### b. PWR DUMP – SUPPLY LINE

Perform <u>PWR DUMP – SUPPLY LINE</u> (ORB OPS, <u>ECLS</u>) p. 5-40. Dump PWR S/Ns 1007, 1025, 2002, 2003, and 2004. MCC-H will TMBU limits. It is not necessary to close the Supply H2O Dump Valve in between each PWR in Step 4.

Dump the PWRs even if they appear empty to ensure any residual air is removed prior to refilling the bags.

Step 6 (POST-DUMP RECONFIG) does not have to be performed immediately following PWR dump termination. Temp stow the PWRs near the Galley for future fills. Stow the B-B hose and R-Y QD in the Ziploc bag and label it "USED" with gray tape. Stow the Ziploc bag in the CHCK.

### 7. CWC Overboard Dump

Verify that the PWR Dumps are complete prior to dumping the CWCs. <u>DO NOT</u> dump PWRs and CWCs at the same time. ISS Technical CWC S/N 1072 must be dumped first to prevent contaminating the bag with a used hose.

Perform <u>CWC OVERBOARD DUMP</u> (ORB OPS, <u>ECLS</u>) p. 5-32. Dump ISS Technical CWC S/N 1072 first, followed by Shuttle Condensate CWC S/N 5050. Begin with Step A then go to Step D. Step C (Heater Activation) is not required; the heater was left on after the Waste Water Dump. MCC will TMBU limits.

Waste nozzle open time will be ~18 minutes for the ISS Technical CWC and ~50 minutes for the Shuttle Condensate CWC. When the CWC dumps are complete, temp stow CWC S/N 5050 for use on FD10. ISS Technical CWC s/n 1072 may be re-stowed at NOD1D2.


# MSG 062A - FD08 FLIGHT PLAN REVISION

1	8.	Lab RWS SSC Reposition
2	٥.	We have noticed the SSCs providing extra camera views for SSRMS Ops have been
		positioned directly behind RWS monitors 1 and 3. There are concerns that this position
3		•
4		may cause the RWS monitors to overheat due to airflow blockage to the monitor fans.
5		Therefore, we have added some time into the timeline today for you to reposition the
6		SSCs to be above the monitors. MSG 069 has some images of how the SSCs were
7		positioned on past missions.
8		
9	9.	FD8 EVA Deltas for Potential Port SARJ Inspection
10		Mike and Ron,
11		As you are aware, consideration is being given to revisit the Port SARJ during EVA 3.
12		We are uplinking a briefing that will point out areas of interest and provide potential
13		changes to EVA 3 Tool Config to include tools that might be used to collect samples.
14		We expect to know early today if this task will be added to EVA 3. Reference MSG 070.
15		The expect to fallow early today is also tack this so added to 2 th toll tollow in 50 or or
16		
17	10	REPLACE PAGES 2-26, 2-28 and 3-80 THROUGH 3-89.
18	10.	THE ENGL 171020 2 20, 2 20 and 0 00 11110000110 00.
19		
20		
21		
22		
23		
24		
25		
26		
27		
28		
29		
30		
31		
32		
33		
34		
35		
36		
37		
38		
39		
40		
41		
42		
43		
44		
45		
46		
47		
48		
49		
50		


								06/07/08	03:19:28		REPLA	NNED
GMT MET	06/07/08 (159) Day 006	1(  2   1		12 15	13 16	14 15 17 18	16 19	17 20	18 21	19 22	20 23	21 007/
	FD08 CDR KELLY	SLEEP	POST S	SLEEP	X U CAM F P CTM MDDK E D RHN MDDK R A YOV XFER T 0*R		CMAN NNT12 MDDK R DNH2 XFER -VO- XFER TR*I	EXERCISE MDD	P E A V K XFER O E N T	MEAL	MDDK XFER	X T X B F A F R E G E I R U R E P F
	PLT HAM	SLEEP	POST S	SLEEP	USR TT	1P PWR MDDK XFEF	FLTR CLN C I	FOAM APP SWAP OPS	CTCX PE WEWFOE CRCE N	MEAL	MDDK XFER	EXER CISE
S T S	MS1 NYBERG	SLEEP	L O POST G	SLEEP	S M R N M V S R AMIA S S C	MDDK XFER	EXERCISE S JE	MRMS-INIT-DEP	-   N  T   T	MEAL	JLP VEST OUTF	FIT 1A
1 2 4	MS2 GARAN	SLEEP	L O POS G	Γ SLEEP	E_LK PREP	EVA TOOL CONF		SE TVCIC TVC	ST N T	MEAL	MDDK XFER	CGSE RACK RCNFG
	MS3 FOSSUM	SLEEP	v A	Γ SLEEP	E_LK PREP	EVA TOOL CONF	X   B   XF   XF	DDK TVCIC TVC ER RMV IN	ST   N	MEAL	MDDK XFER EXERC	CISE
	MS4 HOSHIDE	SLEEP	SD OLD LRSER AYTEY P	POST SLEEP	D J R R A M EXER G S # ^	CISE H JEMRMS BUS MON S/U	R JRMS HRM D M RELEASE R T	MRMS-INIT-DEP	DJ   P E RR   A V LOY AM   O E GS   N #*   T	MEAL	JLP VEST OUTF	TIT 1A
D N	FE-2 REISMAN	SLEEP (8.5)	S L V PS	PW DPC CI	K V N K I T	HANDOVER	CEVIS	TVIS	MEAL		HANDOVER	
E X P	ISS CDR VOLKOV	SLEEP (8.5)	PS *	БМП Ф1 PSDPC PW INI	KNT-2 EXE2	U 0 R B G S A N	RED	A O S U	MEAL	СОЖ-МПТ	O T CEVIS O K	IMS PW
1 7	FE-1 KONONENKO	SLEEP (8.5)	PS	PW DPC 1	CN3 NIIK 1 VE	ELO + RED		ME	AL	КПТ-2-ЕХЕ	TV	/IS
U P	FE-2 CHAMITOFF	SLEEP (8.5)	S L V PS	PW DPC	T M V N I T S	HANDOVER	DCS T/A PMO	C CEVIS	MEAL	ليبيابالييي	HANDOVER	
S T S	ORBIT DAY/NIGHT W -171 TDRS E -46 Z 275 ORB ATT	103	104  BIAS -XLV -	105 		107	108		109  BIAS -XLV	110 -ZVV		
	NOTES		*R	PAO-EVENT	^EVA3 VIEW	BIAS -XLV +YVV STS ^COND TERM -THRU CNCT CT PT2	*STS TO CMG N/INIT ^INSTALL #INST	ΓALL	— BIAS -XLV - *DEACT-P #JEM DRAG	REP PT1 -THRU DSCNCT	г	

GMT 0										06/07/08 03:19:28 <b>REPLANNED</b>				
	06/07/08 (159)		22	' '''	23	06	'' ''  5/08 03	01		02 03 04 05 06 07 08 09 10 1,1 12				
MET	007 Day 007	/00 	01	بنبل	02	بلبياب	03 	04		05 06 07 08 09 10 11 12				
	CDR SLEEP REVIEW PS PMCPS OF A/G			PE AV PS OE N T	PRE SLEEP	MASK PB/TOOL CONFG	PRE	SLEEP	SLEEP					
	ПАН	EXER CISE	EVA 3 PROC REVIEW		PRE SLEEP				PRE SLEEP					SLEEP
S T S	MS1 NYBERG	S M S N EVA 3 PROC PRE SLEEP REVIEW S N R S *					SLEEP							
1 2 4	MS2 GARAN	PS	EVA 3 PROC REVIEW	F	PRE SLI	EEP	MASK PB/TO CONFG	: 10.2	PRE SLEEP	SLEEP  ISS A/L Campout @ 10.2 psi				
	MS3 FOSSUM	PS	EVA 3 PROC REVIEW	F	PRE SLI	EEP	MASK PB/TO CONFG	DPRS OOL	PRE SLEEP	SLEEP				
	MS4 HOSHIDE	S M S N D R V R M R Y S *	EVA 3 PROC REVIEW	PRE SLEEI			PRE SLEEP	Þ	D R Y	SLEEP				
D N	FE-2 REISMAN	F F Q	EVA 3 PROC REVIEW	DPCPW	P A O PS S U	*	PS			SLEEP (8.5)				
E X P	ISS CDR VOLKOV	PW	EVA 3 PROC REVIEW	DPC P	PS	БМП Ф1 END	PS			SLEEP (8.5)				
1 7	FE-1 KONONENKO	TVISE R	EVA 3 PROC REVIEW	DPC PI	W	PS				SLEEP (8.5)				
U P	FE-2 CHAMITOFF	WRM E CWC E INIT	1	DPC W E	TB EA RT MT		PS .			SLEEP (8.5)				
S T S	ORBIT DAY/NIGHT W -171 TDRS E -46 Z 275 ORB ATT	111	11	2		11	3		114	115 116 117 118 119 119 119 119 119 119 119 119 119				
	NOTES	*EVA3				♣PAO-DE/	ACT			FLT DIN/124/FLT				




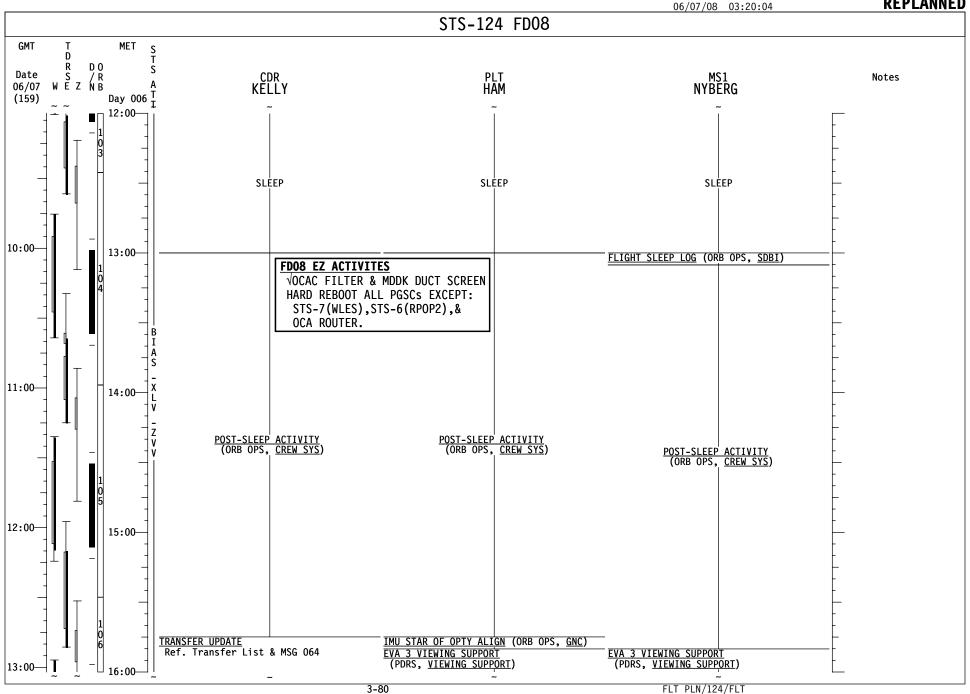




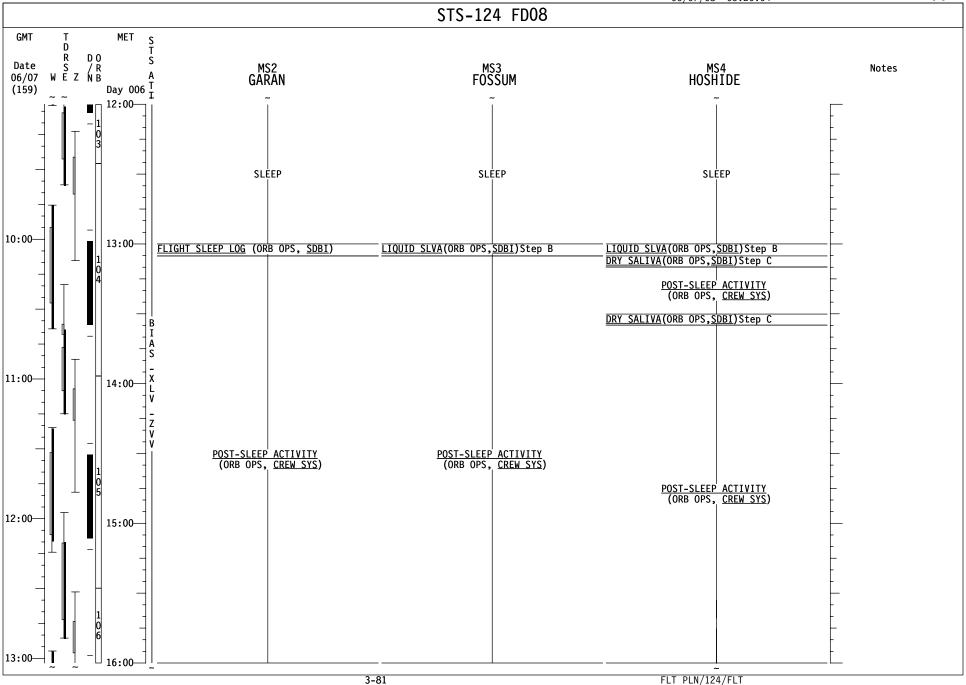

REPLANNED

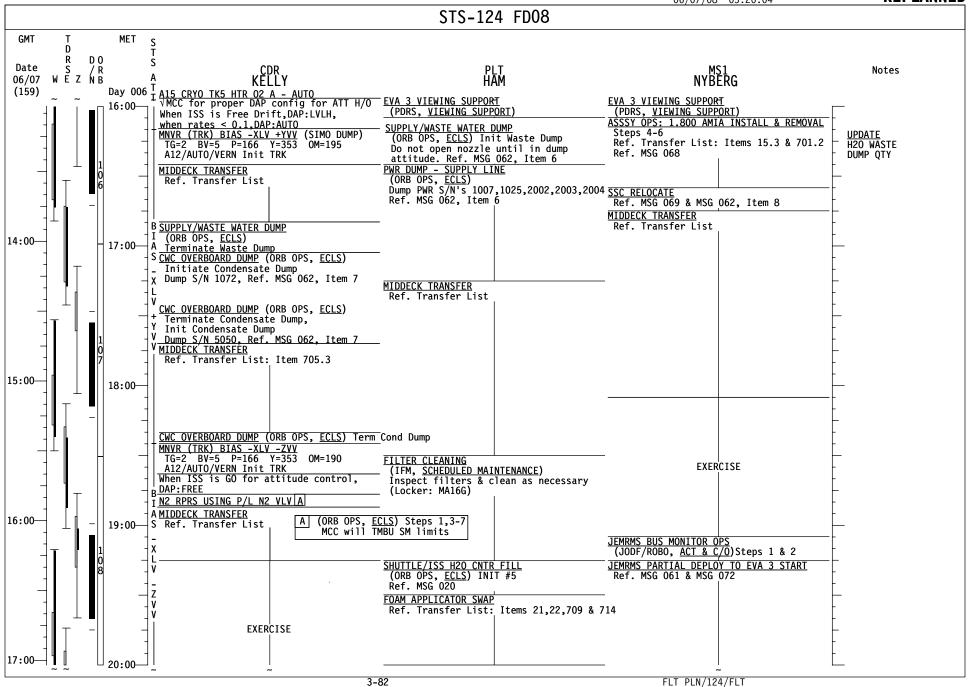


**REPLANNED** 

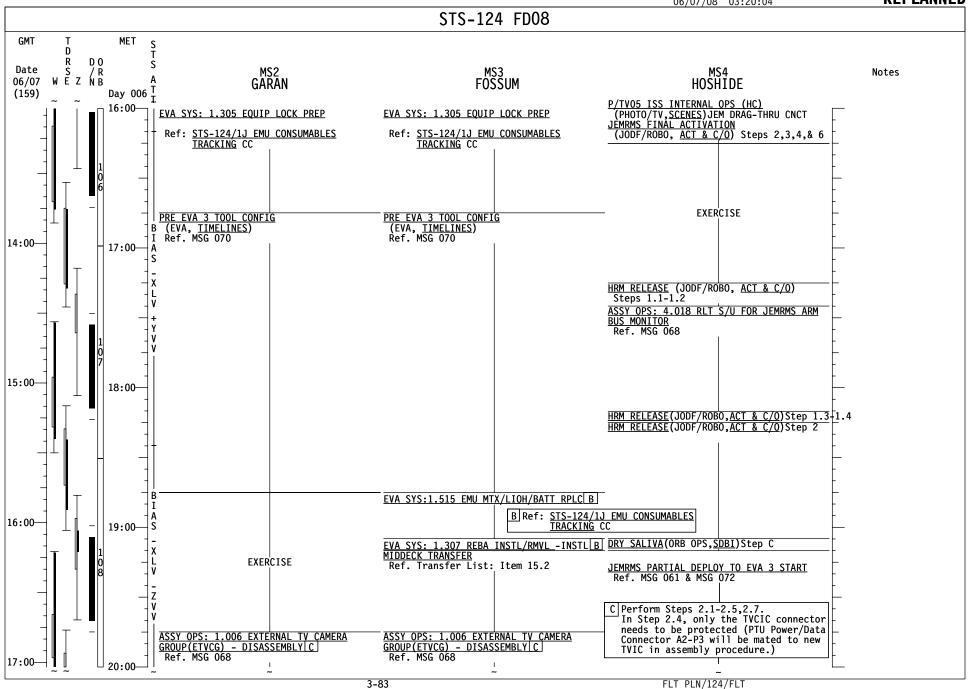




06/07/08 03:20:04

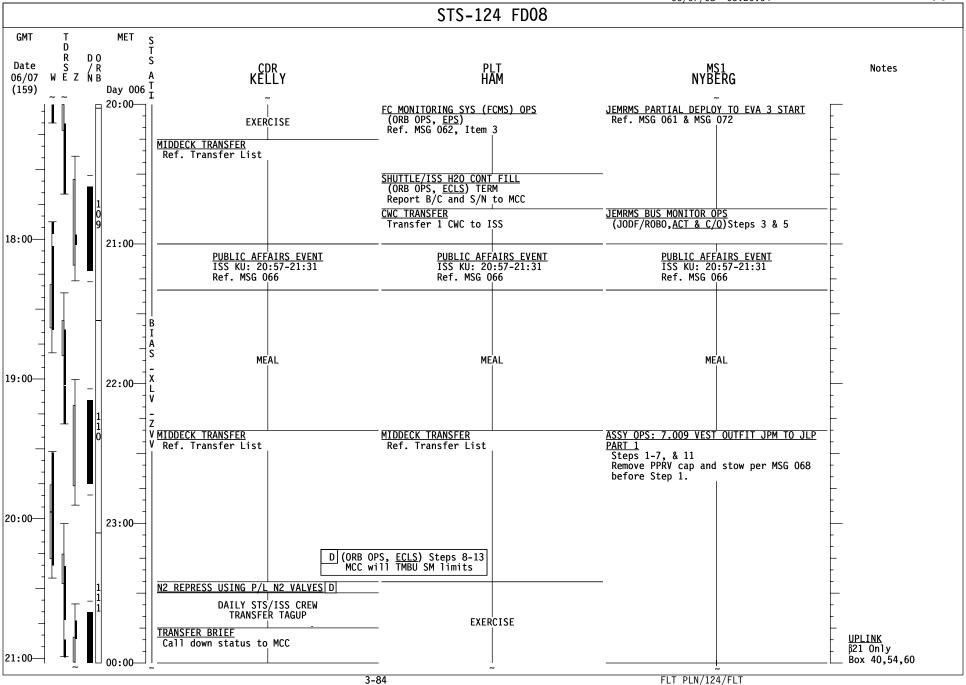


**REPLANNED** 

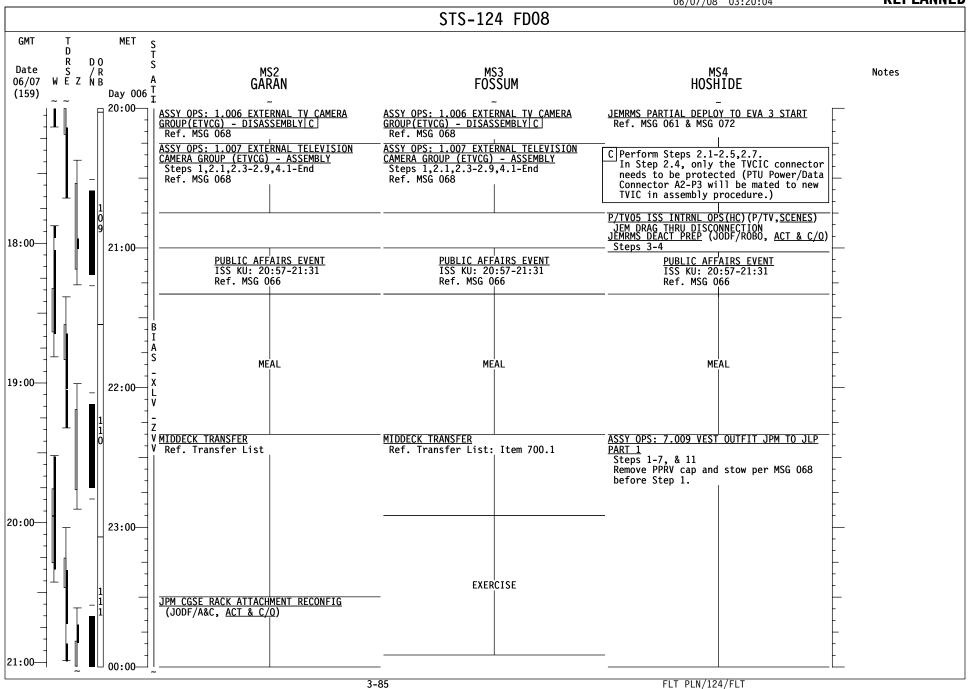





06/07/08 03:20:04

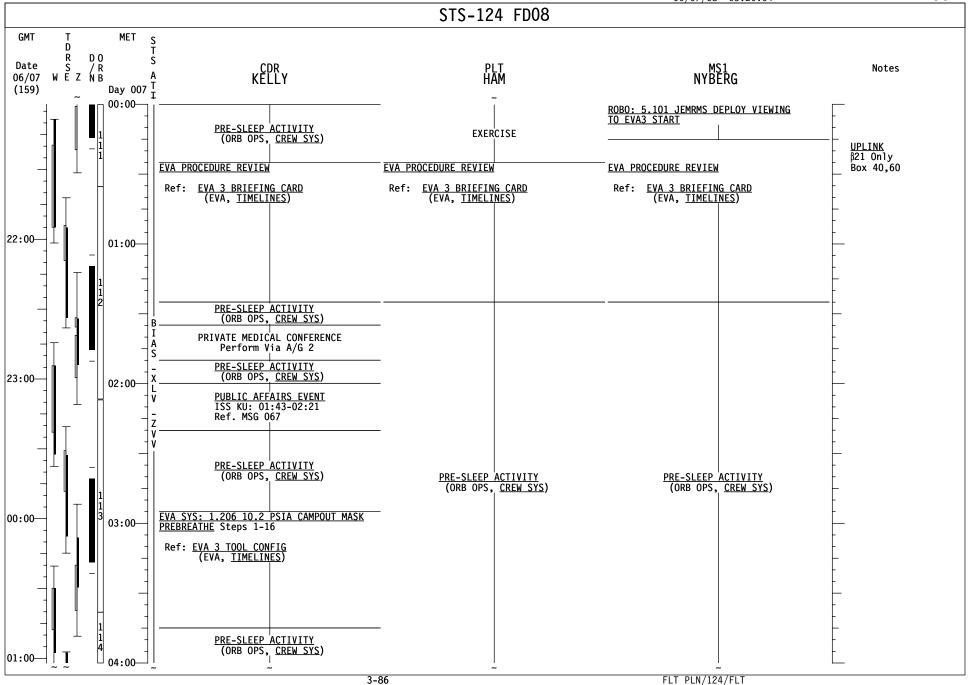



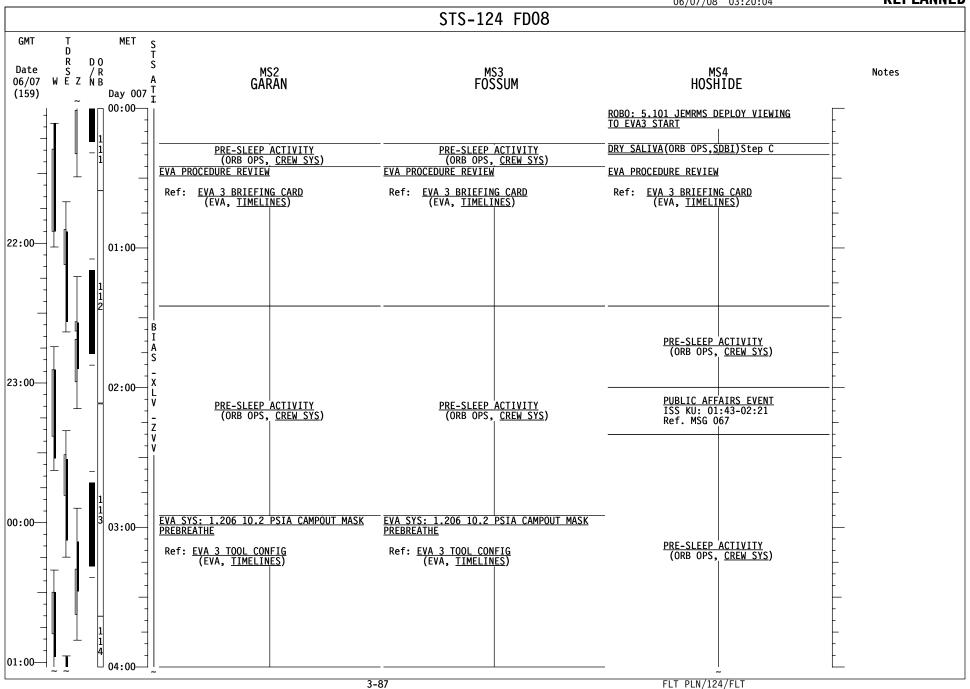

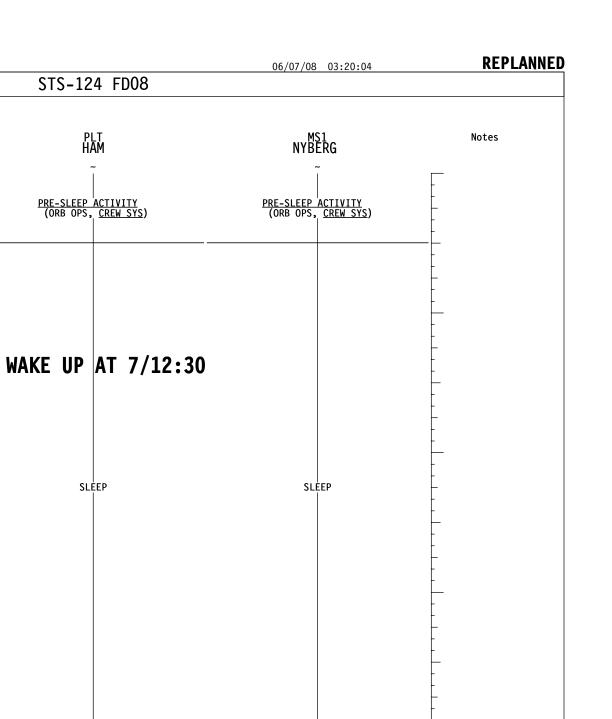

FLT PLN/124/FLT

T D R D O S / R O 6/08 W E Z N B (160)

Day 007 T

05:00-

06:00-

07:00-

CDR KELLY

PRE-SLEEP ACTIVITY
(ORB OPS, CREW SYS)

SLĖEP

3-88


GMT

02:00-

03:00-

04:00-


05:00-

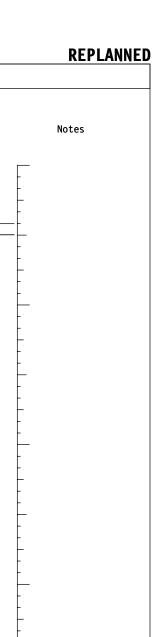



06/07/08 03:20:04

FLT PLN/124/FLT

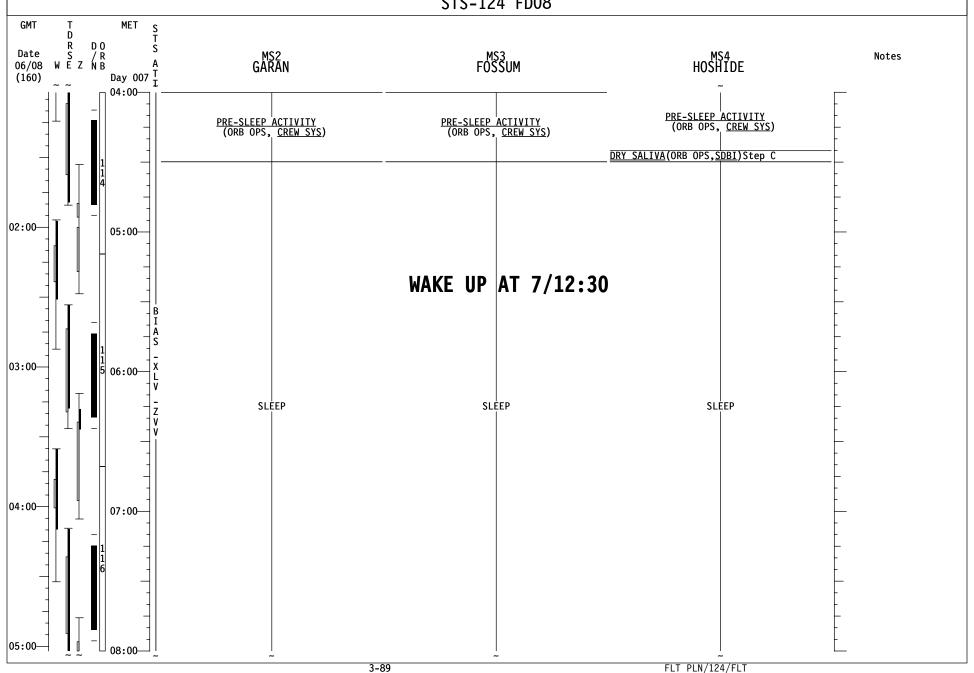

```
1
    Good Morning Discovery!!!
2
3
    Thanks for another day of stellar performance! All of you are doing such an awesome job!
4
5
6
    Have a great day!!!!!
7
8
9
    YOUR CURRENT ORBIT IS: 185 X 181 NM
10
11
    NOTAMS:
12
13
                LAKEBED RUNWAY 15/33 ELS ONLY. OTHER LAKEBED RWYS RED.
    EDW -
14
    NOR -
                LAKEBED RUNWAYS GREEN.
15
    NTU –
                NGU TACAN CH CHANGED TO 86Y.
16
    YJT –
                TACAN CH 78 DME ONLY.
17
    HAW –
                RWY 31 CLOSED. RWY 13 TODA 8,994'.
18
    WAK –
                CLOSED. NOT USABLE.
19
    IKF –
                NOT USABLE. NO AGREEMENT.
20
    BEN -
                NOT RECOMMENDED/NOT SUPPORTED.
21
                FIRST 600M (~2,000') OF RWY 30L NOT AVAILABLE. 10,200'
22
    ZZA –
                REMAINING.
23
    NKT -
                CLOSED
24
25
    NEXT 2 PLS OPPORTUNITIES:
26
27
    EDT22R ORB 110 – 6/22:24
                                  FEW250 250/12P18
28
    NOR23 ORB 125 – 7/21:12
                                  SKC
29
                                           230/14P25
30
    OMS TANK FAIL CAPABILITY:
31
32
33
    L OMS FAILS:
                      NO
                      NO
    R OMS FAILS:
34
35
    LEAKING OMS PRPLT BURN:
36
37
                   ALWAYS BURN RETROGRADE
38
    L OMS LEAK:
                   ALWAYS BURN RETROGRADE
39
    R OMS LEAK:
40
    OMS QUANTITIES(%)
41
42
                      R OMS OX = 30.3
    LOMS OX = 30.3
43
           FU = 29.9
                             FU = 30.3
44
45
    SUBTRACT INTERCONNECT COUNTER TO OBTAIN CURRENT OMS QUANTITIES
46
47
48
49
50
```

1 2

3

# DELTA V AVAILABLE:

ARCS (TOTAL ABOVE QTY1)

9

TOTAL IN THE AFT

ARCS (TOTAL ABOVE QTY2)

FRCS (ABOVE QTY 1)

71 FPS 27 FPS

354 FPS

316 FPS

**38 FPS** 

10 11 12

13

AFT QTY 1 AFT QTY 2

OMS

80 % 42 %

14 15 16

16 17 18

19

EPS
The instrumentation
for the FC3 H2
flowmeter and FC3 cell
performance monitor
(CPM) was lost (a
common fuse may have
opened).

IMPACT
Loss of FC3 cell
performance monitor
(CPM) which provides
insight into the health of
fuel cell 3. Also, loss of
insight into FC3 H2
flows used to monitor
FC purge and other
troubleshooting.

We are bus tied B-C for additional insight into the health of fuel cell 3, and we will need to perform an FCMS data take daily.

**WORK AROUND** 

MCC will use alternate methods to verify fuel cell purge.

20 21

212223

242526

27

33 34 35

36

32

373839

END OF PAGE 2 OF 2, MSG 063

### MSG 064 (17-0364) - FD08 TRANSFER MESSAGE

Page 1 of 5

1 2

Good morning Aki and Mark!

You guys have done great work so far, and we see you ahead of the plan on transfer time! Today is your BIG transfer day, so keep up the good work! Reading our Transfer tea leaves (FAO has a far less charitable phrase for our prediction technique), we see you are currently 86% complete on Resupply, 35% complete on Return, and 52% complete overall!

We thought it might be helpful to offer you some big-picture words for the Russian separator pumps: You brought up a new one in Bag A (transfer list item 15.1), you are going to return a pump in Bag A (transfer list item 700.4), and you are going to return an additional pump in Bag J (transfer list item 706.1). The pump returning in Bag A is the one that was removed on FD5 during the R&R. The pump that is going to return in Bag J is a pump that failed a while back. MCC-M has been working with Sergei and Oleg to pack the pumps for return (containment & bagging), but we do not think that has been completed. Once Sergei and Oleg have them packed up, you can transfer them to Bags A & J.

Mark, your choreography today now includes transferring the BMRRM Bag (transfer list item 705.3). This bag contains several food containers and a Pallet that must be removed prior to transfer. All of these items can be stowed loose in the location of the BMRRM Bag (use ISS bungees if needed). Only the empty bag is returning on 1J.

Reminder: the transfer brief will be held on the big loop today instead of A/G2.

For STS, the Transfer List Excel file, FD08\_Transfer\_List\_STS124.xls, is located on the KFX machine in **C:\OCA-up\transfer**.

For ISS, the Transfer List Excel file, FD08\_Transfer\_List\_STS124.xls, is located in **K:\OCA-up\transfer**.

### FD08 Choreography (items for transfer today)

- Item 701.2 (Karen): Transfer returning AMIA during MDDK XFER activity
- Items 15.2 & 700.1 (Mike): Transfer new and old TVCIC during MDDK XFER before and after the ETVCG R&R
- Items 705.3 (Mark): Transfer the BMRRM Bag during MDDK XFER
- Items 21, 22, 709, & 714 (Ken): Swap Foam Applicators and Duxseal during foam applicator swap activity

### Please update the Transfer List as follows:

On page 7: item 17, strike through "Purge" in the Item Name column.

WAS: Sample Purge Bags IS: Sample Bags

In **RETURN** tab:

In **RESUPPLY** tab:

Replace pages 6, 8, & 13

# MSG 064 (17-0364) - FD08 TRANSFER MESSAGE

Page 2 of 5

FD09 Choreography (items for transfer tomorrow)

- None

Let us know if you have questions.

- The Transfer Team

### MSG 065 - FD07 MMT SUMMARY

1 FD07 MMT Summary

The FD07 MMT briefly met to discuss mission progress and everything continues to proceed very well. Congratulations on another successful EVA! The EVA team has reviewed the glove photos and has cleared them for all subsequent EVAs. The MMT community is working no significant issues and is looking forward to the upcoming JEM RMS activation.

END OF PAGE 1 OF 1, MSG 065

# **17-0368 (MSG 069) - Lab RWS SSC Reposition** Page 1 of 1

We have noticed the SSCs providing extra camera views for SSRMS Ops have been positioned directly behind RWS monitors 1 and 3. There are concerns that this position may cause the RWS monitors to overheat due to airflow blockage to the monitor fans. We would like you to reposition the SSCs to help eliminate this overheating concern. The images below show how the SSCs have been positioned on past Missions.





Page 1 of 1, 17-0368 (MSG 069)

(ROBOTICS/1J - ALL/FIN1)

Page 1 of 23 pages

### **OBJECTIVE:**

Deploy JEMRMS Main Arm (MA) Wrist cluster from launch position, then Partial SY Joint Deploy for EVA 3.

### LOCATION:

JPM1A6 (JEMRMS Console)

### **DURATION:**

1 hour 30 minutes with two crew members

#### NOTE

- 1. Notation"(AOS/M)" indicates that AOS during execution of step is mandatory. If currently LOS, or expecting LOS prior to completion of an AOS/M step, wait for next AOS to perform.
- 2. When Operation Sequence File (OSF) loading is completed, RMS ODF Scenario Set window is automatically closed.
- 3. When mode transition from FOR/Joint Auto to Position Hold is completed in the Operation Procedure File (OPF) operation, MA FOR/Joint Auto Mode window is automatically closed.
- 4. RMS-ODF window buttons:

Step: Proceed to next script line

■ Start: Start RMS-ODF execution

► End: Stop RMS-ODF execution

- 5. When the start or step button is clicked for joint angle calculation, calculation is automatically performed.
- 6. After selecting Proceed in the RLF operation, MA starts moving
- 7. When configuring Video System on RLT(SLT), Monitor should be selected first, then camera.
- 8. For all non-JEM related cameras, the pan, tilt and zoom must be checked on PCS. **MCC-H** can direct you to the appropriate PCS camera status Reader display to obtain telemetry. These displays can be found at:

C&T: Video: Video Status Reader Video Status Reader

9. For MUX view on RMS Mon with US camera view(either shuttle or ISS USOS) and JEM camera view routed, PCS will be used to route MUX view to CVIU input. These PCS displays can be found at:

C&T: Video: Split Screen Routing SCU Split Screen Routing Then, RLT will be used to route this view from CVIU to the target RMS Mon.

\* If required, use MA BRAKES switch to terminate motion.

ii required, use MA DIVANLO SWILCH to terminate motion.

(ROBOTICS/1J - ALL/FIN1)

Page 2 of 23 pages

### 1. CONFIGURING VIDEO SYSTEM FOR WRIST CLUSTER DEPLOY

Configure Cameras as required.

RMS Mon1	RMS Mon2	SSC (V10)
Mux 24: Tip Elbow	EXT A (+94, +8)	71: OBSS ITVC
(+80, -5; Zoom: 2 cm)	,	(+16, -42; HFOV: 10 deg)
/EXT F (-90, +5)		
(09:P1 Lower Outboard	(22: Base Elbow	
+149, -2.3; Zoom: 4.7 cm))	(+75, -5; Zoom: 2 cm))	

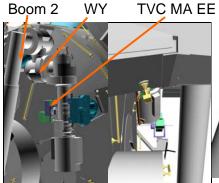


Figure 1.1 - Launch Posn. Mux 24: Tip Elbow (+80, -5; Zoom: 2 cm)

/EXT F (-90, +5)

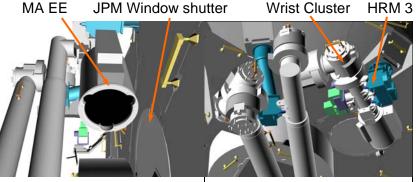


Figure 1.2 - Launch Posn. EXT A (+94, +8)

Figure 1.3 - Launch Posn. 71: OBSS ITVC (+16, -42; HFOV: 10 deg)

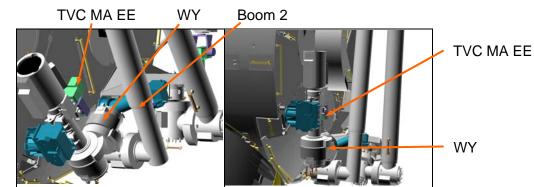


Figure 1.4 - Launch Posn. 09:P1 Lower Outboard (+149, -2.3; Zoom: 4.7 cm)

Figure 1.5 - Launch Posn. 22: Base Elbow (+75, -5; Zoom: 2 cm)

NOTE

Expect Singularity Annunciation through out this task.

# 2. RECORDING MA JOINT ANGLES

RLT JEMRMS: MA

JEMRMS: Main Arm

Record MA Joint Angles after HRM Release.

		9			
SY[J1]	SP[J2]	EP[J3]	WP[J4]	WY[J5]	WR[J6]
-90.0	-51.0	+172.0	-164.0	0.0	+180.0

Expected

(ROBOTICS/1J - ALL/FIN1)

Page 3 of 23 pages

### 3. TRANSITIONING MDP MODE TO BRAKE

Verify Current Mode – Standby

JEMRMS: Mode
JEMRMS: Mode

'Main Arm Control Mode'

**cmd** MA Brake (Verify Current Mode – Brake)

### 4. LOADING OSF

NOTE

OSF takes ~40 sec to load.

JEMRMS: ODF

JEMRMS: RMS ODF

pick File: Open Scenario File - Nominal

JEMRMS: RMS ODF Scenario Set

sel MA\_DEPLOY\_PART1

cmd Load

Verify RMS ODF Scenario Set window is closed.

JEMRMS: ODF

JEMRMS: RMS ODF

Verify Scenario – MA\_DEPLOY\_PART1

### 5. <u>DISENGAGING MA BRAKES</u>

RIP MA BRAKES → OFF (OFF Lt – Illuminated)

RLT Verify Current Mode – Pos Hold

### 6. WRIST CLUSTER JOINT CHECKOUT IN JOINT AUTO

### 6.1 Selecting OPF

JEMRMS: ODF

JEMRMS: RMS ODF

sel 1 MA\_W\_CLUSTER\_JOINT\_CO

cmd Start (

Verify Procedure – MA\_W\_CLUSTER\_JOINT\_CO

(ROBOTICS/1J - ALL/FIN1)

Page 4 of 23 pages

# 6.2 Performing Wrist Cluster Joint Checkout

NOTE

Refer to Joint Angles recorded in step 2 for [J1] to [J6]

		SCRIPT WINDOW	REQD OPERATOR ACTION						
	a.	MA Joint Auto Mode Xtion	[1]						
	_	T IDMO ODEI							
>	l	LT [RMS ODF] nd Mode Change	cmd Step ( L)						
		– MA Joint Auto	Cilia Step ()						
			Verify Current Mode – Joint Auto						
			Verify MA Joint Auto Mode Window is displayed.						
	b.	RMS-RLF Load	[2]						
	RI	LT [RMS ODF]							
>	l	pad rm001jm0	cmd Step ( L)						
			Verify Procedure – rm001jm0						
		b-1. Moving WP For	[3]						
		Wrist Cluster Joint CO							
	>	MA.Joint.Rel_Ang.Calc	cmd Start ( )						
	_		[4]						
			JEMRMS: MA Joint Auto Mode						
			Verify the following items. (within ± 0.3 deg)						
			Joint Moving Plan: WP						
			Joint SY SP EP WP WY WR Current -90.0 -51.0 +172.0 -164.0 0.0 +180.0 Expected						
			Current -90.0 -51.0 +172.0 -164.0 0.0 +180.0 Expected (Current) [J1] [J2] [J3] [J4] [J5] [J6]						
			Target [J1] [J2] [J3] [J4] [J5] [J6]						
			-0.2						
			Error 0.0 0.0 0.0 +0.2 0.0 0.0						
			[5]						
		RLT [MA Joint Auto]							
	>	Enable {Proceed}	cmd Step ( L)						
			IEMPMS: MA Joint Auto Mode						
			JEMRMS: MA Joint Auto Mode Verify Ready – blue						
			Verify Proceed is active.						
			(AOS/M) [6]						
			NOTE						
	>	Push {Proceed}	Joint motion is ~15 sec.  cmd Proceed						
			Verify In Progress – blue						
			, , , , , , , , , , , , , , , , , , ,						
		When In Progress – gray,							
		Verify the following items. (within ± 0.3 deg)  Joint SY SP EP WP WY WR							
			Current [J1] [J2] [J3] [J4] [J5] [J6]						

(ROBOTICS/1J - ALL/FIN1)

Page 5 of 23 pages

### 6.3 Aborting JEM RMS-OPF

### NOTE

1. When the JEM RMS-OPF is aborted, following message will occur on RLT.

'Consl Config RMS ODF Execution Error' This message can be ignored.

2. When abort cmd send, RMS ODF Abort window is automatically closed.

JEMRMS: ODF

JEMRMS: RMS ODF

cmd Abort ( )

JEMRMS: RMS ODF Abort

'Select Abort ODF Type in the List'

sel RMS-OPF cmd Execute

JEMRMS: RMS ODF

Verify Procedure – not displayed

(ROBOTICS/1J - ALL/FIN1)

Page 6 of 23 pages

### 7. DEPLOYING WRIST AND ELBOW JOINT IN JOINT AUTO

### 7.1 Recording MA Joint Angles And Transitioning MDP Mode To Pos Hold

JEMRMS: MA

JEMRMS: Main Arm

Record MA Joint Angles after Wrist Cluster Joint Checkout.

SY[J1a]	SP[J2a]	EP[J3a]	WP[J4a]	WY[J5a]	WR[J6a]
-90.0	-51.0	+172.0	-164.2	+0.0	+180.0

**Expected** 

Verify Current Mode – Joint Auto

JEMRMS: Mode
JEMRMS: Mode

'Main Arm Control Mode'

cmd MA Position Hold (Verify Current Mode – Pos Hold)

On SSIPC GO.

### 7.2 Selecting OPF

JEMRMS: ODF

JEMRMS: RMS ODF sel 2 MA\_DEPLOY

cmd Start ( )

Verify Procedure - MA\_DEPLOY

### 7.3 Deploying Wrist Joint In Joint Auto

NOTE

Refer to Joint Angles recorded in step 7.1 for [J1a] to [J6a]

	SCRIPT WINDOW	REQD OPERATOR ACTION	
	a. MA Joint Auto Mode Xtion		[1]
	RLT [RMS ODF]		
	and Made Change		
>	cmd Mode Change	cmd Step ( L)	
	<ul><li>– MA Joint Auto</li></ul>	Verify Current Mode – Joint Auto.	
		Verify MA Joint Auto Mode Window is displayed.	
	b. RMS-RLF Load		[2]
	RLT [RMS ODF]		
>	Load rm002jm0	cmd Step ( L)	
		Verify Procedure – rm002jm0	
		,	
	b-1. Moving WP For		[3]
	MA Deploy		• •
	> MA.Joint.Abs_Ang.Calc	cmd Start ( )	
		,	

# **17-0361 (MSG 072) - 1.104 JEMRMS PARTIAL DEPLOY TO EVA 3 START** (ROBOTICS/1J - ALL/FIN1) Page 7 of 23 pages

	SCRIPT WINDOW	REQD OPERATOR ACTION
		[4]  JEMRMS: MA Joint Auto Mode  Verify the following items. (within ± 0.3 deg)  Joint Moving Plan: WP  Joint SY SP EP WP WY WR  Current -90.0 -51.0 +172.0 -164.2 +0.0 +180.0 (Current) [J1a] [J2a] [J3a] [J4a] [J5a] [J6a]  Target [J1a] [J2a] [J3a] -173.0 [J5a] [J6a]  Error 0.0 0.0 0.0 [J4a] 0.0 0.0 0.0 +173.0
	RLT [MA Joint Auto] > Enable {Proceed}	9 cm clearance between MA EE and JPM Window shutter is maintained during WP rotation. Monitor this clearance using EXT A.  cmd Step ( L)  JEMRMS: MA Joint Auto Mode Verify Ready – blue Verify Proceed is active.
:	> Push {Proceed}	NOTE   Joint motion is ~60 sec.     Cmd Proceed   Verify In Progress – blue   [7]   When In Progress – gray,   Verify the following items. (within ± 0.3 deg)   Joint   SY   SP   EP   WP   WY   WR
:	b-2. Moving WY For MA Deploy MA.Joint.Abs_Ang.Calc	Current [J1a] [J2a] [J3a] -173.0 [J5a] [J6a]  [8]  cmd Step ( ••)
		[9]  JEMRMS: MA Joint Auto Mode  Verify the following items. (within ± 0.3 deg)  Joint Moving Plan: WY  Joint SY SP EP WP WY WR  Current -90.0 -51.0 +172.0 -173.0 +0.0 +180.0 Expected  (Current) [J1a] [J2a] [J3a] -173.0 [J5a] [J6a]  Target [J1a] [J2a] [J3a] -173.0 +7.0 [J6a]  Error 0.0 0.0 0.0 0.0 [J5a] 0.0  -7.0

# **17-0361 (MSG 072) - 1.104 JEMRMS PARTIAL DEPLOY TO EVA 3 START** (ROBOTICS/1J - ALL/FIN1) Page 8 of 23 pages

	SCRIPT WINDOW	REQD OPERATOR ACTION	
^	RLT [MA Joint Auto] Enable {Proceed}	cmd Step ( L)	[10]
		JEMRMS: MA Joint Auto Mode  Verify Ready – blue  Verify Proceed is active.	
			[11]
٨	Push {Proceed}	NOTE Joint motion is ~45 sec.  cmd Proceed Verify In Progress – blue	
		When In Progress – gray, Verify the following items. (within ± 0.3 deg)  Joint SY SP EP WP WY WR  Current [J1a] [J2a] [J3a] -173.0 +7.0 [J6a]	[12]

(ROBOTICS/1J - ALL/FIN1)

Page 9 of 23 pages

SPEE

### 7.4 Verifying Wrist Cluster Deployed

Verify Wrist Cluster Deployed Posn

TVC MA EE SPEE(Cannot seen as in backside) Boom 2 JPM Endcone JPM Endcone

Figure 3.1 - Wrist Cluster Deployed 24: Tip Elbow (+80, -5; Zoom: 2 cm) /EXT F (-90, +5)

Figure 3.2 - Wrist Cluster Deployed EXT A (+94, +8)

Figure 3.3 - Wrist Cluster Deployed 71: OBSS ITVC (+16, -42; HFOV: 10 deg)

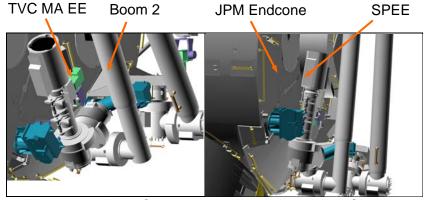


Figure 3.4 - Wrist Cluster Deployed 09:P1 Lower Outboard (+149, -2.3; Zoom: 4.7 cm)

Figure 3.5 - Wrist Cluster Deployed 22: Base Elbow (+75, -5; Zoom: 2 cm)

(ROBOTICS/1J - ALL/FIN1)

Page 10 of 23 pages

# 7.5 <u>Deploying Boom 3 Clear Of HRM 3 In Joint Auto</u>

NOTE

Refer to Joint Angles recorded in step 7.1 for [J1a] to [J6a]

	SCRIPT WINDOW	REQD OPERATOR ACTION		
>	b-3. Moving WR For MA Deploy	cmd Step ( )		
	MA.Joint.Abs_Ang.Calc			
		[2]  JEMRMS: MA Joint Auto Mode  Verify the following items. (within ± 0.3 deg)  Joint Moving Plan: WR  Joint SY SP EP WP WY WR  Current -90.0 -51.0 +172.0 -173.0 +7.0 +180.0 (Current) [J1a] [J2a] [J3a] -173.0 +7.0 [J6a]  Target [J1a] [J2a] [J3a] -173.0 +7.0 +90.0 Error 0.0 0.0 0.0 0.0 0.0 [J6a] -90.0		
>	RLT [MA Joint Auto] Enable {Proceed}	NOTE  1. The clearance between TVC MA EE and MA Boom 2 decreases to 11 cm during WR rotation. Monitor this clearance using Tip Elbow.  2. The clearance between SPEE and JPM Endcone decreases to 8 cm during WR rotation. Monitor this clearance using EXT A.  cmd Step ( )  JEMRMS: MA Joint Auto Mode Verify Ready – blue Verify Proceed is active.		
>	Push {Proceed} 	NOTE Joint motion is ~3:23  cmd Proceed Verify In Progress – blue		
		When In Progress – gray, Verify the following items. (within ± 0.3 deg)  Joint SY SP EP WP WY WR  Current [J1a] [J2a] [J3a] -173.0 +7.0 +90.0		

(ROBOTICS/1J - ALL/FIN1)

Page 11 of 23 pages

# 7.6 Verifying Wrist Roll Deployed Posn

Verify Wrist Roll Deployed Posn

WR Handrail (Cannot seen as in backside)

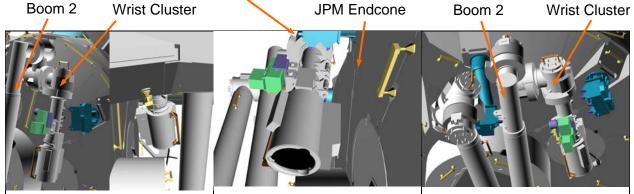


Figure 4.1 - Wrist Roll Deployed 24: Tip Elbow (+80, -5; Zoom: 2 cm) /EXT F (-90, +5)

Figure 4.2 - Wrist Roll Deployed EXT A (+94, +8)

Figure 4.3 - Wrist Roll Deployed 71: OBSS ITVC (+16, -42; HFOV: 10 deg)

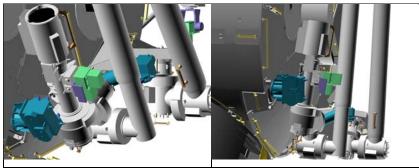


Figure 4.4 - Wrist Roll Deployed 09:P1 Lower Outboard (149, -2.3; Zoom: 4.7 cm)

Figure 4.5 - Wrist Roll Deployed 22: Base Elbow (+75, -5; Zoom: 2 cm)

### 7.7 Deploying Wrist Yaw Joint In Joint Auto

**NOTE** 

Refer to Joint Angles recorded in step 7.1 for [J1a] to [J3a]

# **17-0361 (MSG 072) - 1.104 JEMRMS PARTIAL DEPLOY TO EVA 3 START** (ROBOTICS/1J - ALL/FIN1) Page 12 of 23 pages

	N
JEMRMS: MA Joint Auto Mode  Verify the following items. (within ± 0.3 degated Joint Moving Plan: WY  Joint SY SP EP WP WY  Current -90.0 -51.0 +172.0 -173.0 +7.0 (Current) [J1a] [J2a] [J3a] -173.0 +7.0  Target [J1a] [J2a] [J3a] -173.0 +88.0  Error 0.0 0.0 0.0 0.0 -81.0  NOTE  1. The clearance between Wrist Clust MA EE) and MA Boom 2 decreases	[1]
Verify the following items. (within ± 0.3 deg Joint Moving Plan: WY  Joint SY SP EP WP WY  Current -90.0 -51.0 +172.0 -173.0 +7.0 (Current) [J1a] [J2a] [J3a] -173.0 +7.0 Target [J1a] [J2a] [J3a] -173.0 +88.0 Error 0.0 0.0 0.0 0.0 -81.0  NOTE  1. The clearance between Wrist Clus MA EE) and MA Boom 2 decreases	
1. The clearance between Wrist Clus MA EE) and MA Boom 2 decreases	WR 0 +90.0 Expected 0 +90.0 0 +90.0
using OBSS ITVC.  2. The clearance between WR Handrail Endcone decreases to 7 cm du rotation. Monitor this clearance using  cmd Step ( )  JEMRMS: MA Joint Auto Mode Verify Ready – blue	to 21 cm clearance I and JPM uring WY
Verify Proceed is active.  NOTE  Joint motion is ~4:13  > Push {Proceed}  cmd Proceed  Verify In Progress – blue	[4]
When In Progress – gray,  Verify the following items. (within ± 0  Joint SY SP EP WP W	0.3 deg) VY WR -88.0 +90.0
> RLT [RMS ODF] Enable End button  cmd Step ( ) Verify Status – Completed Verify End button is active.  cmd End ( )	[6]

(ROBOTICS/1J - ALL/FIN1)

Page 13 of 23 pages

### 7.8 Configuring Video System For Boom2 Clear Of HRM 2

Configure Cameras as required.

RMS Mon1	RMS Mon2	SSC (V10)
Mux 24: Tip Elbow	EXT A (+94, +8)	71: OBSS ITVC
(+80, -5; Zoom: 2 cm)		(+16, -42; HFOV: 10 deg)
/EXT F (-80, -30; Z = 2)		
(22: Base Elbow	(22: Base Elbow	
(+75, -5; Zoom: 2 cm))	(+75, -5; Zoom: 2 cm))	

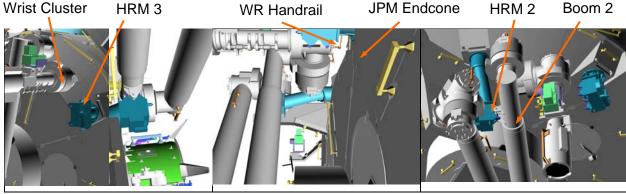


Figure 5.1 - Wrist Yaw
Deployed
Mux 24: Tip Elbow
(+80, -5; Zoom: 2 cm)
/EXT F (-80, -30; Z = 2)

Figure 5.2 - Wrist Yaw Deployed EXT A (+94, +8)

Figure 5.3 - Wrist Yaw Deployed 71: OBSS ITVC (+16, -42; HFOV: 10 deg)

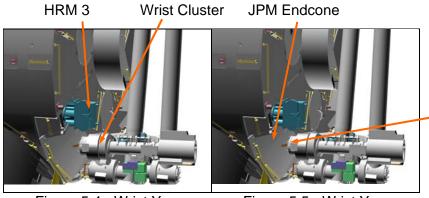


Figure 5.4 - Wrist Yaw
Deployed
22: Base Elbow
(+75, -5; Zoom: 2 cm)

Figure 5.5 - Wrist Yaw Deployed 22: Base Elbow (+75, -5; Zoom: 2 cm)

WR Handrail

(ROBOTICS/1J - ALL/FIN1)

Page 14 of 23 pages

# 7.9 <u>Deploying Elbow Joint In Joint Auto</u>

NOTE

Refer to Joint Angles recorded in step 7.1 for [J1a] to [J3a]

		SCRIPT WINDOW	REQD OPERATOR ACTION			
	C.	RMS-RLF Load	[1]			
>		_T [RMS ODF] pad rm003jm0	cmd Step ( ) Verify Procedure – rm003jm0			
		c-1. Moving EP For Elbow Cluster Joint CO	[2]			
	>	MA.Joint.Rel_Ang.Calc	cmd Start ( )			
			[3]  JEMRMS: MA Joint Auto Mode  Verify the following items. (within ± 0.3 deg)  Joint Moving Plan: EP  Joint SY SP EP WP WY WR  Current -90.0 -51.0 +172.0 -173.0 +88.0 +90.0 (Current) [J1a] [J2a] [J3a] -173.0 +88.0 +90.0 Target [J1a] [J2a] [J3a] -173.0 +88.0 +90.0 -0.2  Error 0.0 0.0 +0.2 0.0 0.0 0.0			
	^	RLT [MA Joint Auto] Enable {Proceed}	cmd Step ( )  JEMRMS: MA Joint Auto Mode  Verify Ready – blue  Verify Proceed is active.			
	^	Push {Proceed}	NOTE Joint motion is ~14 sec.  cmd Proceed Verify In Progress – blue			
			When In Progress – gray, Verify the following items. (within ± 0.3 deg)  Joint SY SP EP WP WY WR Current [J1a] [J2a] [J3a] -173.0 +88.0 +90.0  Record EP[J3b] Current Joint Angle: deg			

# **17-0361 (MSG 072) - 1.104 JEMRMS PARTIAL DEPLOY TO EVA 3 START** (ROBOTICS/1J - ALL/FIN1) Page 15 of 23 pages

	SCRIPT WINDOW	REQD OPERATOR ACTION
^	c-2. Moving EP For MA Deploy	cmd Step ( )
	MA.Joint.Abs_Ang.Calc	
		NOTE     Refer to Joint Angles recorded in Step 7.9 Block     [6] (previous page) for [J3b]     JEMRMS: MA Joint Auto Mode     Verify the following items. (within ± 0.3 deg)     Joint Moving Plan: EP   WP   WY   WR     Current   -90.0   -51.0 +171.8   -173.0   +88.0   +90.0     Current   [J1a]   [J2a]   [J3b]   -173.0   +88.0   +90.0     Target   [J1a]   [J2a]   +169.0   -173.0   +88.0   +90.0     Error   0.0   0.0   [J3b]   0.0   0.0   0.0
٨	RLT [MA Joint Auto] Enable {Proceed}	NOTE  1. The clearance between HRM 3 and Wrist Cluster (WR) decreases to 10 cm during EP rotation. Monitor this clearance using Tip Elbow.  2. The clearance between WR Handrail and JPM Endcone increases to 10 cm during EP rotation. Monitor this clearance using EXT A.  cmd Step (
		Verify Ready – blue Verify Proceed is active.  [10]  NOTE  Joint motion is ~38 sec
^	Push {Proceed}	cmd Proceed Verify In Progress – blue
		When In Progress – gray, Verify the following items. (within ± 0.3 deg)  Joint SY SP EP WP WY WR  Current [J1a] [J2a] +169.0 -173.0 +88.0 +90.0

(ROBOTICS/1J - ALL/FIN1)

Page 16 of 23 pages

# 7.10 Configuring Video System For Boom1 Clear Of HRM 1

Configure Cameras as required.

RMS Mon1	RMS Mon2	SSC (V10)
Mux 24: Tip Elbow	EXT A (+88, -47)	71: OBSS ITVC
(+80, -5; Zoom: 2 cm)		(+16, -42; HFOV: 10 deg)
/EXT F (-80, -20)		
(22: Base Elbow	(22: Base Elbow	
(+75, -6; Zoom: 2 cm))	(+80, 0; Zoom: 1.2 cm))	

Handrail on JEM AL HRM 3
Boom 2

TVC ELBOW JPM Endcone HRM 2

Boom 2

Figure 6.1 - Boom1 Clear of HRM 1 Tip Elbow (+80, -5; Zoom: 2 cm) /EXT F (-80, -20)

Figure 6.2 - Boom1 Clear of HRM 1 EXT A (+88, -47)

Figure 6.3 - Boom1 Clear of HRM 1 71: OBSS ITVC (+16, -42; HFOV: 10 deg)

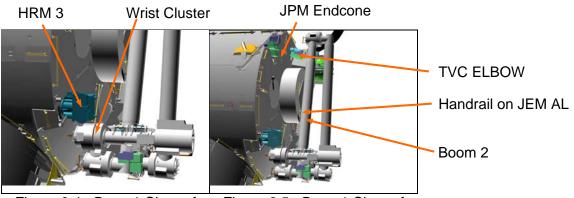


Figure 6.4 - Boom1 Clear of HRM 1 22: Base Elbow (+75, -6; Zoom: 2 cm)

Figure 6.5 - Boom1 Clear of HRM 1 22: Base Elbow (+80, 0; Zoom: 1.2 cm)

(ROBOTICS/1J - ALL/FIN1)

Page 17 of 23 pages

# 7.11 <u>Deploying Shoulder Pitch Joint In Joint Auto</u>

NOTE

Refer to Joint Angles recorded in step 7.1 for [J1a] to [J2a]

	SCRIPT WINDOW	REQD OPERATOR ACTION				
	c-3. Moving SP For Shoulder Cluster Joint CO MA.Joint.Rel_Ang.Calc	cmd Step ( Li)				
		[2]  JEMRMS: MA Joint Auto Mode  Verify the following items. (within ± 0.3 deg)  Joint Moving Plan: SP  Joint SY SP EP WP WY WR  Current -90.0 -51.0 +169.0 -173.0 +88.0 +90.0 (Current) [J1a] [J2a] +169.0 -173.0 +88.0 +90.0 Target [J1a] [J2a] +169.0 -173.0 +88.0 +90.0 +0.2  Error 0.0 -0.2 0.0 0.0 0.0 0.0 0.0				
>	RLT [MA Joint Auto] Enable {Proceed}	cmd Step ( )  JEMRMS: MA Joint Auto Mode  Verify Ready – blue  Verify Proceed is active.				
>	Push {Proceed}	NOTE Joint motion is ~17 sec.  cmd Proceed Verify In Progress – blue				
		When In Progress – gray,   Verify the following items. (within ± 0.3 deg)   Joint   SY   SP   EP   WP   WY   WR     Current   [J1a]   [J2a]   +169.0   -173.0   +88.0   +90.0     Record SP[J2b] Current Joint Angle: deg				
>	c-4. Moving SP For MA Deploy MA.Joint.Abs_Ang.Calc	cmd Step (				

# **17-0361 (MSG 072) - 1.104 JEMRMS PARTIAL DEPLOY TO EVA 3 START** (ROBOTICS/1J - ALL/FIN1) Page 18 of 23 pages

SCRIPT WINDOW	REQD OPERATOR ACTION					
	[7]					
	NOTE  Refer to Joint Angles recorded in Step 7.11 Block					
	[5] (previous page) for [J2b]					
	JEMRMS: MA Joint Auto Mode					
	Verify the following items. (within ± 0.3 deg)					
	Joint Moving Plan: SP					
	Joint         SY         SP         EP         WP         WY         WR           Current         -90.0         -50.8         +169.0         -173.0         +88.0         +90.0         Expected					
	(Current) [J1a] [J2b] +169.0 -173.0 +88.0 +90.0					
	Target [J1a] -48.0 +169.0 -173.0 +88.0 +90.0					
	Error 0.0 [J2b] 0.0 0.0 0.0 0.0 0.0					
	+48.0					
	[8]					
	[0]					
	<u>NOTE</u>					
	1. 9 cm clearance between Handrail on JEM AL					
	and MA Boom 2 is maintained during SP rotation. Monitor this clearance using EXT F.					
	Totalion. Worldon this clearance asing EXTT.					
	2. 15 cm clearance between TVC ELBOW and					
	JPM Endcone is maintained during SP					
RLT [MA Joint Auto]	rotation. Motitor this clearance using EXT A.					
> Enable {Proceed}	cmd Step ( )					
	JEMRMS: MA Joint Auto Mode					
	Verify Ready – blue					
	Verify Proceed is active.					
	[9]					
	NOTE IOI					
	Joint motion is ~33 sec.					
Duch (Proceed)	and Drass d					
> Push {Proceed}	<b>cmd</b> Proceed Verify In Progress – blue					
	Volliy III i Togress Dide					
	[10]					
	When In Progress – gray,					
	Verify the following items. (within ± 0.3 deg)					
	Joint SY SP EP WP WY WR					
	Current   [J1a]   -48.0 +169.0  -173.0  +88.0  +90.0					

(ROBOTICS/1J - ALL/FIN1)

Page 19 of 23 pages

### 8. DEPLOYING SHOULDER YAW JOINT IN JOINT AUTO AND JOINT OCAS

### 8.1 Configuring Video System For Shoulder Yaw Deploy

Configure Cameras as required.

RMS Mon1	RMS Mon2	SSC (V10)
Mux 24: Tip Elbow	EXT A (+71, -48)	71: OBSS ITVC
(+80, -5; Zoom: 2 cm)		(+16, -42; HFOV: 10 deg)
/EXT F (-80, -20)		
(22: Base Elbow	(22: Base Elbow	
(+75, -6; Zoom: 2 cm))	(+80, 0; Zoom: 1.2 cm))	


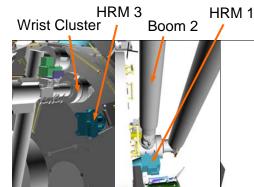


Figure 7.1 - Shoulder Yaw Deploy 24: Tip Elbow (+80, -5; Zoom: 2 cm) /EXT F (-80, -20)

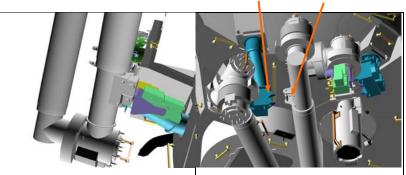

HRM 2

Boom 2

Figure 7.2 - Shoulder Yaw Deploy EXT A (+71, -48)

Figure 7.3 - Shoulder Yaw Deploy 71: OBSS ITVC (+16, -42; HFOV: 10 deg)



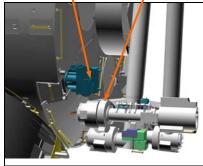


Figure 7.4 - Shoulder Yaw Deploy 22: Base Elbow (+75, -6; Zoom: 2 cm)

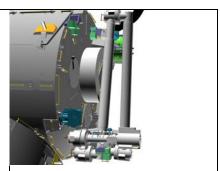


Figure 7.5 - Shoulder Yaw Deploy 22: Base Elbow (+80, 0; Zoom: 1.2 cm)

(ROBOTICS/1J - ALL/FIN1)

Page 20 of 23 pages

# 8.2 Performing Shoulder Yaw Cluster Joint Checkout

NOTE

Refer to Joint Angle[J1a] recorded in step 7.1.

	SCRIPT WINDOW	REQD OPERATOR ACTION				
^	c-5. Moving SY For Shoulder Cluster Joint CO	cmd Step (				
	MA.Joint.Rel_Ang.Calc					
		JEMRMS: MA Joint Auto Mode  Verify the following items. (within ± 0.3 deg)  Joint Moving Plan: SY  Joint SY SP EP WP WY WR				
		Current         -90.0         -48.0         +169.0         -173.0         +88.0         +90.0         Expected           (Current)         [J1a]         -48.0         +169.0         -173.0         +88.0         +90.0           Target         [J1a]         -48.0         +169.0         -173.0         +88.0         +90.0           +0.2         +0.2         0.0         0.0         0.0         0.0         0.0				
^	RLT [MA Joint Auto] Enable {Proceed}	cmd Step ( )  JEMRMS: MA Joint Auto Mode  Verify Ready – blue  Verify Proceed is active.				
^	Push {Proceed}	NOTE Joint motion is ~16 sec.  cmd Proceed Verify In Progress – blue				
		When In Progress – gray, Verify the following items. (within ± 0.3 deg)  Joint SY SP EP WP WY WR  Current [J1a] -48.0 +169.0 -173.0 +88.0 +90.0 +0.2  Record SY[J1b] Current Joint Angle: deg				

(ROBOTICS/1J - ALL/FIN1)

Page 21 of 23 pages

### 8.3 Aborting JEM RMS-ODF

### NOTE

3. When the JEM RMS-ODF is aborted, following message will occur on RLT.

### 'Consl Config RMS ODF Execution Error'

This message can be ignored.

4. When abort cmd send, RMS ODF Abort window is automatically closed.

JEMRMS: ODF

JEMRMS: RMS ODF

cmd Abort (



JEMRMS: RMS ODF Abort

'Select Abort ODF Type in the List'

sel RMS-OSF

cmd Execute

JEMRMS: RMS ODF

Verify Scenario - not displayed

### 8.4 Transitioning MDP Mode To Joint OCAS

JEMRMS: Mode

JEMRMS: Mode

**cmd** MA Position Hold (Verify Current Mode – Pos Hold)

cmd MA Joint OCAS (Verify Current Mode – Joint OCAS)

### 8.5 Setting Target Joint Angles And Scale Factors

NOTE

Refer to Joint Angle[J1b] recorded in step 8.2 block 5.

JEMRMS: MA Joint OCAS Mode

Input 'Target' joint angles and 'Scale Factor' for SY Partial Posn. Press [Enter].

Joint	SY	SP	EP	WP	WY	WR
(Current)	[J1b]	-48.0	+169.0	-173.0	+88.0	+90.0
Target	-67.0	-48.0	+169.0	-173.0	+88.0	+90.0
Scale	7.3	10.0	10.0	10.0	10.0	10.0
Factor:						
%						

(ROBOTICS/1J - ALL/FIN1)

Page 22 of 23 pages

Verify the followings. (within  $\pm$  0.1 deg for Current, Target and Error, within  $\pm$  0.01 deg/sec for Max Rate)

	man = ere r degree er man r tatte,						
Joint	SY	SP	EP	WP	WY	WR	
(Current)	[J1b]	-48.0	+169.0	-173.0	+88.0	+90.0	
Target	-67.0	-48.0	+169.0	-173.0	+88.0	+90.0	
Error	[J1b] + 67	0.0	0.0	0.0	0.0	0.0	
Max Rate: deg/sec	4.50	4.50	4.50	4.50	4.50	4.50	
Scale Factor: %	7.3	10.0	10.0	10.0	10.0	10.0	

### 8.6 Verifying Ready To Arm Motion

cmd Load

Verify Ready – blue

Verify Proceed is active.

### 8.7 Moving MA to SY Partial Position

### NOTE

- 1. Joint motion is ~1:26. After selecting Proceed in the OCAS operation, MA starts moving.
- 2. The clearance between HRM 3 and Wrist Cluster (WR) decreases to 11 cm during SY rotation. Monitor this clearance using Tip Elbow.

### cmd Proceed

Verify In Progress – blue

When In Progress - gray,

Verify MA Joint Angles. (within ± 0.3 deg)

		,		<u> </u>	
SY	SP	EP	WP	WY	WR
-67.0	-48.0	+169.0	-173.0	+88.0	+90.0

(ROBOTICS/1J - ALL/FIN1)

Page 23 of 23 pages

### 8.8 Verifying EVA 3 Start Posn

Verify EVA 3 Start Posn.

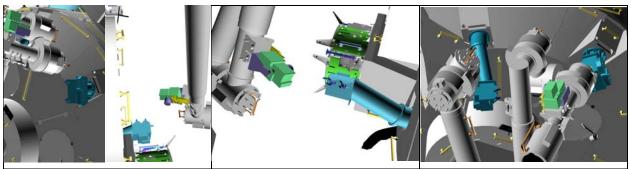


Figure 8.1 - EVA3 Start Posn 24: Tip Elbow (+80, -5; Zoom: 2 cm) /EXT F (-80, -20))

Figure 8.2 - EVA3 Start Posn EXT A (+71, -48)

Figure 8.3 - EVA3 Start Posn 71: OBSS ITVC (+16, -42; HFOV: 10 deg)

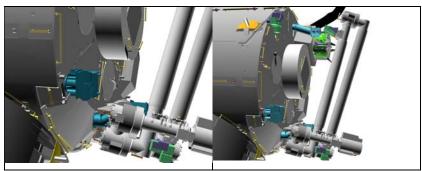


Figure 8.4 - EVA3 Start Posn 22: Base Elbow (+75, -6; Zoom: 2 cm)

Figure 8.4 - EVA3 Start Posn 22: Base Elbow (+80, 0; Zoom: 1.2 cm)

### 8.9 Transitioning MDP Mode To Position Hold

JEMRMS: MA Joint OCAS Mode

cmd Close (Verify MA Joint OCAS Mode window is closed)

JEMRMS: Mode

JEMRMS: Mode

'Main Arm Control Mode'

**cmd** MA Position Hold (Verify Current Mode – Pos Hold)

### 9. ENGAGING MA BRAKES

RIP MA BRAKES → ON (ON Lt – Illuminated)

RLT Verify Current Mode – Brake

Notify SSIPC, "JEMRMS Partial Deploy to EVA 3 Start complete".

06 JUN 08 1\_104\_JEMRMS\_PARTIAL\_DEPLOY\_TO\_EVA\_3\_START(080606a).doc